


## Ocean Bay/Village, K-78

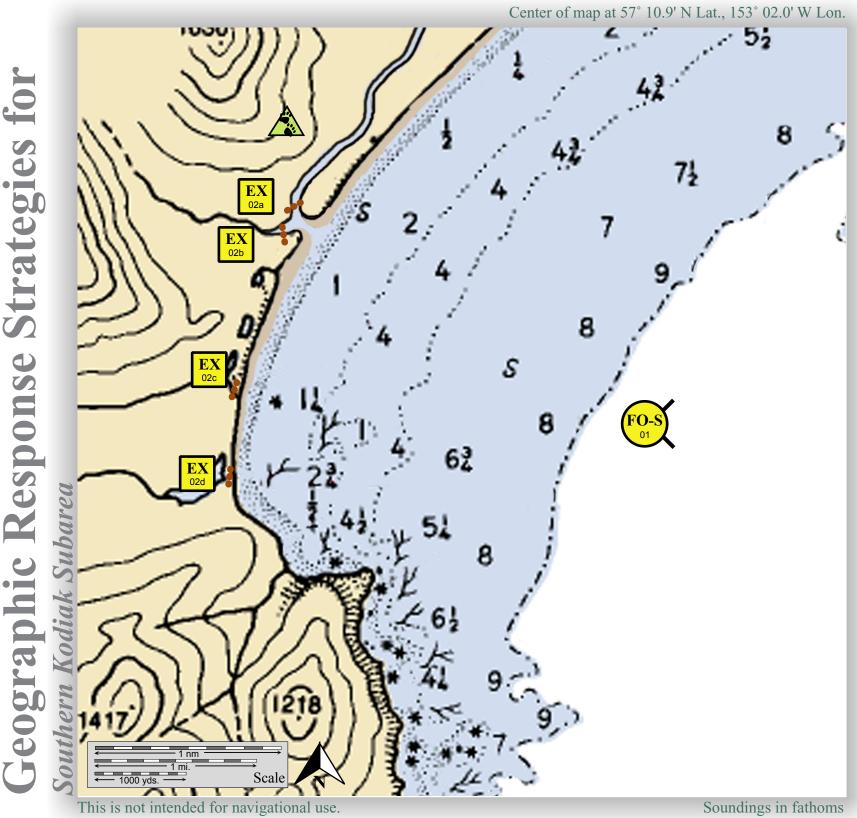

Kodiak Subarea Geographic Response Strategies

DRAFT October 30, 2008

ID	Location and Description	Response Strategy	Implementation	Response Resources	Staging Area	Site Access	Resources Protected (months)	Special Considerations
K-78-01	Ocean Bay Nearshore waters in the general area of:  Lat. 57°27.53' N Lon. 152°28.31'W	Free-oil Recovery  Maximize free-oil recovery in the offshore & nearshore environment of Ocean Bay depending on spill location and trajectory.	Deploy free-oil recovery strike teams upwind and up current of Ocean Bay.  Use aerial surveillance to locate incoming slicks.	Deploy multiple free-oil recovery strike teams as required to maximize interception of oil before it impacts the sensitive areas in Ocean Bay.	Vessel Platform	Via marine waters Chart 16592-1	Same as K-78-02	Vessel master should have local knowledge.  Use extreme caution, shoal waters with numerous reefs and rocks.
K-78-02	Ocean Bay  a. Lat. 57°04.71'N Lon. 153°12.70'W  b. Lat. 57°04.66'N Lon. 153°12.82'W  c. Lat. 57°04.06'N Lon. 153°13.23'W  d. Lat. 57°03.73'N Lon. 153°13.21'W	Exclusion Exclude oil from entering the streams and intertidal area in Ocean Bay.	Access is possible via ATV trail from Port Hobron.  For each stream, place fast-water boom at an angle to exclude oil from entering.  All anchors can be deployed without vessel support.  Tend throughout the tide.  Boom Lengths:  a. 300 ft.  b. 200 ft.  c. 100 ft.  d. 100 ft.	Personnel/Shift  2 ea. vessel crew/general tech  Personnel/Shift  2 ea. vessel crew/general tech  Tending  Vessels  ATV w/ trailer  Personnel/Shift  2 ea. vessel crew/general tech  Tending  Vessels  ATV w/ trailer  Personnel/Shift  2 ea. vessel crew/general tech	Old Harbor Boat Harbor.	Via ATV Trail. Chart 16592-1	Fish- intertidal spawning- salmon (May-Sept.), herring(April-May)  Birds-waterfowl concentration, seabird nesting  Marine mammals- seals, otters  Habitat- marsh, sheltered rocky shoreline, gravel beaches  Human uses-commercial fishing, subsistence	Vessel master should have local knowledge. Site not surveyed. Tested: not yet